

September 6, 2023

Mr. Jason Samples  
Valley R-IV School District  
#1 Viking Drive  
Caledonia, MO 63631

**RE: Drinking Water Sampling – Valley Junior and Senior High School**  
#1 Viking Drive  
Caledonia, MO 63631  
**Project Number: 923206**

Mr. Samples,

OCCU-TEC, Inc. (OCCU-TEC) is pleased to present the following report for drinking water sampling completed at Valley Junior and Senior High School in Caledonia, Missouri. The sampling was requested and approved by Mr. Jason Samples of Valley R-IV School District (VSD). OCCU-TEC completed drinking water sampling of all potential drinking water sources, sources used in food preparation, and utensil cleaning. Drinking water sampling was completed in accordance with the requirements set forth in Missouri Senate Bill #681/662 known as the "Get the Lead Out of School Drinking Water Act".

## **METHODOLOGY**

On August 1<sup>st</sup>, 2023, Mr. Nathaniel Jones of OCCU-TEC completed testing of nineteen (19) sources throughout Valley Junior and Senior High School. Samples were collected as 'First Draw' samples after the fixtures had remained unused for a minimum period of 8 hours. Samples were collected in dedicated, laboratory-provided 250-milliliter plastic sample containers. Sample location information and photographic documentation are noted in the attached table.

Samples were shipped to Teklab, Inc. (Teklab) of Collinsville, Illinois for analysis using EPA method 200.8. Teklab is approved for sample analysis by the Missouri Department of Natural Resources (MDNR) under certification number 00930. A copy of the laboratory analytical results and Chain of Custody documentation are attached to this report.

## RESULTS

Samples results were compared to the regulatory limit of 5 parts per billion (ppb) outlined in Missouri Senate Bill 681/662. Of the samples collected, four (4) of the nineteen (19) samples contained lead concentrations at or above 5 ppb. Below is a list of samples containing elevated concentrations of lead.

206-VHS-07	High School East Wing	Drinking Fountain Bubbler	7.9
206-VHS-12	High School West Wing	Drinking Fountain Bubbler (Left Unit)	5.9
206-VHS-18	Kitchen	Kitchen Dish Sprayer	12.4
206-VHS-20	Kitchen	Faucet with Dish Sprayer	9.8

## LIMITATIONS

At the request of VSD, bathroom sinks and janitorial closet sinks were excluded from sampling. OCCU-TEC recommends placing signage on all sources not sampled during this assessment that indicate the source is not to be used for drinking water.

## RECOMMENDATIONS

The following recommendations are in accordance with Senate Bill 681/662.

In accordance with the requirements set forth in Missouri Bill 681/662, fixtures exhibiting lead concentrations above 5 ppb must be remediated by replacement of lead-containing pipes, solder, fittings or fixtures with lead-free components, or the school shall install filtration at each point where water enters the building until such time as the source can be remediated. If installing a filter is not feasible, the school shall provide purified water at each outlet inventoried.

Additionally, any water coolers or drinking water outlets identified by the United States Environmental Protection Agency (EPA) as not being lead-free under the federal Lead Contamination Control Act of 1988 shall be replaced unless the unit has been tested and determined to have lead results under 5 ppb.

Within two weeks after receiving test results, the school shall make all testing results and any lead remediation plans available on the school's website. The school shall notify parents and staff via written notification within seven (7) business days after receiving test results exceeding 5 ppb. The notification shall include the following:

- Test results and a summary explaining the results.
- A description of any remedial steps taken.


- A description of the general health effects of lead contamination and community specific resources.
- Provide bottled water if there is not enough water to meet the drinking water needs of the students, teachers, and staff.

For fixtures exhibiting results above 5 ppb, follow up random "Flush" sampling shall be conducted annually on at least 25-percent of the remediated outlets until all outlets have been remediated. Drinking water sampling shall be conducted annually and annual drinking water test results shall be submitted by the district to the Department of Health and Senior Services (MDHSS).

### **SIGNATURE(S)**

OCCU-TEC appreciates the opportunity to provide the above referenced consulting services to the VSD. If you have any questions regarding the contents of this report, please contact us at (816) 231-5580.

Respectfully,

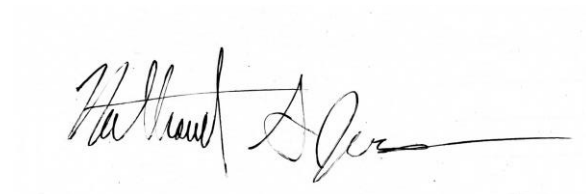

Nathaniel Jones  
Environmental Scientist





Kevin Heriford  
Director EH&S Dept. (QA/QC)


### **ATTACHMENTS**

Outlet Inventory with Analytical Results Summary  
Laboratory Analytical Results and COC Documentation


Drinking Water Assessment  
Valley High School  
Valley School District


ID:	206-VHS-01	Location:	Admin Office	
Photo:		Manufacturer:	Unknown	
		Description:		
		South Wall Main Office Kitchenette Sink		
		Result:	1.8	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				


ID:	206-VHS-02	Location:	Jr. High East Wing	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bottle Filler		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				

ID:	206-VHS-03	Location:	Jr. High East Wing	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bubbler, Left		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				

Drinking Water Assessment  
Valley High School  
Valley School District


ID:	206-VHS-04	Location:	Jr. High East Wing	
Photo:		Manufacturer:	Halsey-Taylor (?)	
		Description:		
		Drinking Fountain Bubbler, Right (Non-Functional)		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				

ID:	206-VHS-05	Location:	High School Center	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bottle Filler, near Men's Restroom		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				


ID:	206-VHS-06	Location:	High School Center	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bubbler		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				




Drinking Water Assessment  
Valley High School  
Valley School District


ID:	206-VHS-07	Location:	High School East Wing	
Photo:		Manufacturer:	Elkay	
		Description:		
		Standalone Drinking Fountain Bubbler		
Result:			ppb	
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				


ID:	206-VHS-08	Location:	Home Ec. Classroom	
Photo:		Manufacturer:	Unknown	
		Description:		
		NW Kitchenette Sink		
Result:		1.4	ppb	
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				

ID:	206-VHS-09	Location:	Home Ec. Classroom	
Photo:		Manufacturer:	Unknown	
		Description:		
		NE Kitchenette Sink		
Result:		1.2	ppb	
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				


Drinking Water Assessment  
Valley High School  
Valley School District


ID:	206-VHS-10	Location:	Home Ec. Classroom	
Photo:		Manufacturer:	Unknown	
		Description:		
		SE Kitchenette Sink		
		Result:	1.6	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				


ID:	206-VHS-11	Location:	Home Ec. Classroom	
Photo:		Manufacturer:	Unknown	
		Description:		
		SW Kitchenette Sink		
		Result:	3.7	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				

ID:	206-VHS-12	Location:	High School West Wing	
Photo:		Manufacturer:	Halsey-Taylor	
		Description:		
		Drinking Fountain Bubbler, Left		
		Result:		ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				

Drinking Water Assessment  
Valley High School  
Valley School District

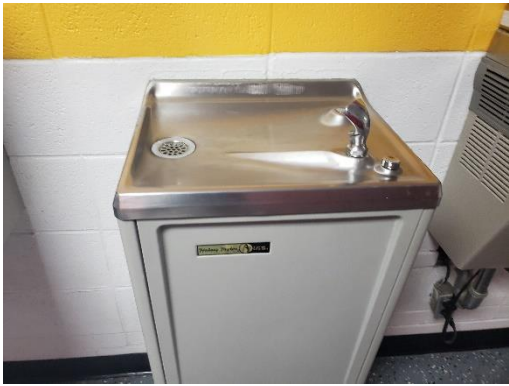
ID:	206-VHS-13	Location:	High School West Wing	
Photo:		Manufacturer:	Halsey-Taylor	
		Description:		
		Drinking Fountain Bubbler, Center (Non-Functional)		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				


ID:	206-VHS-14	Location:	High School West Wing	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bottle Filler		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				


ID:	206-VHS-15	Location:	High School West Wing	
Photo:		Manufacturer:	Elkay	
		Description:		
		Drinking Fountain Bubbler, Right		
		Result:	<1.0	ppb
		Date Sampled:	8/1/2023	By: NJ
Recommended Action:				




Drinking Water Assessment  
Valley High School  
Valley School District


ID:	206-VHS-16	Location:	Kitchen	
Photo:		Manufacturer:	Watts	
		Description:		
		Dishwashing Sink, Left		
		Result:	<1.0	ppb
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				


ID:	206-VHS-17	Location:	Kitchen	
Photo:		Manufacturer:	Watts	
		Description:		
		Dishwashing Sink, Right		
		Result:	<1.0	ppb
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				

ID:	206-VHS-18	Location:	Kitchen	
Photo:		Manufacturer:	T&S Brass Co.	
		Description:		
		Kitchen Dish Sprayer		
		Result:		ppb
Date Sampled:		8/1/2023	By:	NJ
Recommended Action:				


Drinking Water Assessment  
Valley High School  
Valley School District

ID:	206-VHS-19	Location:	Kitchen		
Photo:		Manufacturer:	Chicago Faucet Co.		
		Description:			
		Center Island Pot Filler (Non-Functional)			
		Result:	<1.0	ppb	
Recommended Action:		Date Sampled:	8/1/2023	By:	NJ

ID:	206-VHS-20	Location:	Kitchen		
Photo:		Manufacturer:	T&S Brass Co.		
		Description:			
		Sink Faucet with Kitchen Dish Sprayer			
		Result:		ppb	
Recommended Action:		Date Sampled:	8/1/2023	By:	NJ

ID:	206-VHS-21	Location:	Faculty Lounge		
Photo:		Manufacturer:	Unknown		
		Description:			
		Kitchenette Sink			
		Result:	<1.0	ppb	
Recommended Action:		Date Sampled:	8/1/2023	By:	NJ

Drinking Water Assessment  
Valley High School  
Valley School District

ID:	206-VHS-22	Location:	Baseball F. Concessions	
Photo:		Manufacturer:	Delta	
		Description:		
		Concession Sink		
		Result:	4.1	ppb
Recommended Action:		Date Sampled:	8/1/2023	By: NJ

September 05, 2023

Justin Arnold  
Occu-Tec  
2604 NE Industrial Drive  
Suite 230  
North Kansas, MO 64117  
TEL: (816) 810-3276  
FAX:



Illinois	100226
Kansas	E-10374
Louisiana	05002
Louisiana	05003
Oklahoma	9978

**RE:** 923206 VHS

**WorkOrder:** 23080301

Dear Justin Arnold:

TEKLAB, INC received 19 samples on 8/3/2023 11:50:00 AM for the analysis presented in the following report.

Samples are analyzed on an as received basis unless otherwise requested and documented. The sample results contained in this report relate only to the requested analytes of interest as directed on the chain of custody. NELAP accredited fields of testing are indicated by the letters NELAP under the Certification column. Unless otherwise documented within this report, Teklab Inc. analyzes samples utilizing the most current methods in compliance with 40CFR. All tests are performed in the Collinsville, IL laboratory unless otherwise noted in the Case Narrative.

All quality control criteria applicable to the test methods employed for this project have been satisfactorily met and are in accordance with NELAP except where noted. The following report shall not be reproduced, except in full, without the written approval of Teklab, Inc.

If you have any questions regarding these tests results, please feel free to call.

Sincerely,



Patrick Riley  
Project Manager  
(618)344-1004 ex 44  
[patrickriley@teklabinc.com](mailto:patrickriley@teklabinc.com)



## Report Contents

<http://www.teklabinc.com/>

**Client:** Occu-Tec

**Work Order:** 23080301

**Client Project:** 923206 VHS

**Report Date:** 05-Sep-23

**This reporting package includes the following:**

Cover Letter	1
Report Contents	2
Definitions	3
Case Narrative	5
Accreditations	6
Laboratory Results	7
Receiving Check List	26
Chain of Custody	Appended



**Client:** Occu-Tec

**Work Order:** 23080301

**Client Project:** 923206 VHS

**Report Date:** 05-Sep-23

### Abbr Definition

\* Analytes on report marked with an asterisk are not NELAP accredited

**CCV** Continuing calibration verification is a check of a standard to determine the state of calibration of an instrument between recalibration.

**CRQL** A Client Requested Quantitation Limit is a reporting limit that varies according to customer request. The CRQL may not be less than the MDL.

**DF** Dilution factor is the dilution performed during analysis only and does not take into account any dilutions made during sample preparation. The reported result is final and includes all dilution factors.

**DNI** Did not ignite

**DUP** Laboratory duplicate is a replicate aliquot prepared under the same laboratory conditions and independently analyzed to obtain a measure of precision.

**ICV** Initial calibration verification is a check of a standard to determine the state of calibration of an instrument before sample analysis is initiated.

**IDPH** IL Dept. of Public Health

**LCS** Laboratory control sample is a sample matrix, free from the analytes of interest, spiked with verified known amounts of analytes and analyzed exactly like a sample to establish intra-laboratory or analyst specific precision and bias or to assess the performance of all or a portion of the measurement system.

**LCSD** Laboratory control sample duplicate is a replicate laboratory control sample that is prepared and analyzed in order to determine the precision of the approved test method. The acceptable recovery range is listed in the QC Package (provided upon request).

**MBLK** Method blank is a sample of a matrix similar to the batch of associated sample (when available) that is free from the analytes of interest and is processed simultaneously with and under the same conditions as samples through all steps of the analytical procedures, and in which no target analytes or interferences should present at concentrations that impact the analytical results for sample analyses.

**MDL** "The method detection limit is defined as the minimum measured concentration of a substance that can be reported with 99% confidence that the measured concentration is distinguishable from method blank results."

**MS** Matrix spike is an aliquot of matrix fortified (spiked) with known quantities of specific analytes that is subjected to the entire analytical procedures in order to determine the effect of the matrix on an approved test method's recovery system. The acceptable recovery range is listed in the QC Package (provided upon request).

**MSD** Matrix spike duplicate means a replicate matrix spike that is prepared and analyzed in order to determine the precision of the approved test method. The acceptable recovery range is listed in the QC Package (provided upon request).

**MW** Molecular weight

**NC** Data is not acceptable for compliance purposes

**ND** Not Detected at the Reporting Limit

**NELAP** NELAP Accredited

**PQL** Practical quantitation limit means the lowest level that can be reliably achieved within specified limits of precision and accuracy during routine laboratory operation conditions.

**RL** The reporting limit the lowest level that the data is displayed in the final report. The reporting limit may vary according to customer request or sample dilution. The reporting limit may not be less than the MDL.

**RPD** Relative percent difference is a calculated difference between two recoveries (ie. MS/MSD). The acceptable recovery limit is listed in the QC Package (provided upon request).

**SPK** The spike is a known mass of target analyte added to a blank sample or sub-sample; used to determine recovery deficiency or for other quality control purposes.

**Surr** Surrogates are compounds which are similar to the analytes of interest in chemical composition and behavior in the analytical process, but which are not normally found in environmental samples.

**TIC** Tentatively identified compound: Analytes tentatively identified in the sample by using a library search. Only results not in the calibration standard will be reported as tentatively identified compounds. Results for tentatively identified compounds that are not present in the calibration standard, but are assigned a specific chemical name based upon the library search, are calculated using total peak areas from reconstructed ion chromatograms and a response factor of one. The nearest Internal Standard is used for the calculation. The results of any TICs must be considered estimated, and are flagged with a "T". If the estimated result is above the calibration range it is flagged "ET"

**TNTC** Too numerous to count ( > 200 CFU )

**Client:** Occu-Tec

**Work Order:** 23080301

**Client Project:** 923206 VHS

**Report Date:** 05-Sep-23

### Qualifiers

- |   |  |
|---|--|
| # - Unknown hydrocarbon                               | B - Analyte detected in associated Method Blank              |
| C - RL shown is a Client Requested Quantitation Limit | E - Value above quantitation range                           |
| H - Holding times exceeded                            | I - Associated internal standard was outside method criteria |
| J - Analyte detected below quantitation limits        | M - Manual Integration used to determine area response       |
| ND - Not Detected at the Reporting Limit              | R - RPD outside accepted recovery limits                     |
| S - Spike Recovery outside recovery limits            | T - TIC(Tentatively identified compound)                     |
| X - Value exceeds Maximum Contaminant Level           |  |



## Case Narrative

<http://www.teklabinc.com/>

**Client:** Occu-Tec

**Work Order:** 23080301

**Client Project:** 923206 VHS

**Report Date:** 05-Sep-23

**Cooler Receipt Temp:** NA °C

### Locations

#### Collinsville

**Address** 5445 Horseshoe Lake Road  
Collinsville, IL 62234-7425  
**Phone** (618) 344-1004  
**Fax** (618) 344-1005  
**Email** jhriley@teklabinc.com

#### Collinsville Air

**Address** 5445 Horseshoe Lake Road  
Collinsville, IL 62234-7425  
**Phone** (618) 344-1004  
**Fax** (618) 344-1005  
**Email** EHurley@teklabinc.com

#### Springfield

**Address** 3920 Pintail Dr  
Springfield, IL 62711-9415  
**Phone** (217) 698-1004  
**Fax** (217) 698-1005  
**Email** KKlostermann@teklabinc.com

#### Chicago

**Address** 1319 Butterfield Rd.  
Downers Grove, IL 60515  
**Phone** (630) 324-6855  
**Fax**  
**Email** arenner@teklabinc.com

#### Kansas City

**Address** 8421 Nieman Road  
Lenexa, KS 66214  
**Phone** (913) 541-1998  
**Fax** (913) 541-1998  
**Email** jhriley@teklabinc.com

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23

State	Dept	Cert #	NELAP	Exp Date	Lab
Illinois	IEPA	100226	NELAP		Collinsville
Kansas	KDHE	E-10374	NELAP		Collinsville
Louisiana	LDEQ	05002	NELAP		Collinsville
Louisiana	LDEQ	05003	NELAP		Collinsville
Oklahoma	ODEQ	9978	NELAP		Collinsville
Arkansas	ADEQ	88-0966			Collinsville
Illinois	IDPH	17584			Collinsville
Iowa	IDNR	430			Collinsville
Kentucky	UST	0073			Collinsville
Missouri	MDNR	00930			Collinsville
Missouri	MDNR	930			Collinsville

**Client:** Occu-Tec  
**Client Project:** 923206 VHS  
**Lab ID:** 23080301-001  
**Matrix:** DRINKING WATER

**Work Order:** 23080301  
**Report Date:** 05-Sep-23  
**Client Sample ID:** 206-VHS-01  
**Collection Date:** 08/01/2023 9:26

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			1.8	µg/L	1	09/01/2023 8:30	



**Client:** Occu-Tec  
**Client Project:** 923206 VHS  
**Lab ID:** 23080301-002  
**Matrix:** DRINKING WATER

**Work Order:** 23080301  
**Report Date:** 05-Sep-23  
**Client Sample ID:** 206-VHS-02  
**Collection Date:** 08/01/2023 9:30

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/01/2023 8:34	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-003**Client Sample ID:** 206-VHS-03**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:30

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/01/2023 8:38	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-004**Client Sample ID:** 206-VHS-05**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:35

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/01/2023 8:41	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-005**Client Sample ID:** 206-VHS-06**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:35

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/01/2023 11:04	



## Laboratory Results

<http://www.teklabinc.com/>

Client: Occu-Tec  
Client Project: 923206 VHS  
Lab ID: 23080301-006  
Matrix: DRINKING WATER

Work Order: 23080301  
Report Date: 05-Sep-23  
Client Sample ID: 206-VHS-07  
Collection Date: 08/01/2023 9:40

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			7.9	µg/L	1	09/01/2023 8:49	





## Laboratory Results

<http://www.teklabinc.com/>

Client: Occu-Tec  
Client Project: 923206 VHS  
Lab ID: 23080301-007  
Matrix: DRINKING WATER

Work Order: 23080301  
Report Date: 05-Sep-23  
Client Sample ID: 206-VHS-08  
Collection Date: 08/01/2023 9:42

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			1.4	µg/L	1	09/01/2023 8:52	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-008**Client Sample ID:** 206-VHS-09**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:42

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			1.2	µg/L	1	09/01/2023 9:06	

**Client:** Occu-Tec **Work Order:** 23080301  
**Client Project:** 923206 VHS **Report Date:** 05-Sep-23  
**Lab ID:** 23080301-009 **Client Sample ID:** 206-VHS-10  
**Matrix:** DRINKING WATER **Collection Date:** 08/01/2023 9:42

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			1.6	µg/L	1	09/01/2023 10:29	



## Laboratory Results

<http://www.teklabinc.com/>

Client: Occu-Tec  
Client Project: 923206 VHS  
Lab ID: 23080301-010  
Matrix: DRINKING WATER

Work Order: 23080301  
Report Date: 05-Sep-23  
Client Sample ID: 206-VHS-11  
Collection Date: 08/01/2023 9:42

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			3.7	µg/L	1	09/01/2023 10:33	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-011**Client Sample ID:** 206-VHS-12**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:55

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			5.9	µg/L	1	09/01/2023 10:42	



**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-012**Client Sample ID:** 206-VHS-14**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:55

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/01/2023 10:46	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-013**Client Sample ID:** 206-VHS-15**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 9:55

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	09/05/2023 8:31	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-014**Client Sample ID:** 206-VHS-16**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 10:01

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	08/31/2023 23:26	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-015**Client Sample ID:** 206-VHS-17**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 10:01

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	08/31/2023 23:29	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-016**Client Sample ID:** 206-VHS-18**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 10:01

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			12.4	µg/L	1	08/31/2023 23:33	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-017**Client Sample ID:** 206-VHS-20**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 10:01

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			9.8	µg/L	1	09/05/2023 9:03	

**Client:** Occu-Tec**Work Order:** 23080301**Client Project:** 923206 VHS**Report Date:** 05-Sep-23**Lab ID:** 23080301-018**Client Sample ID:** 206-VHS-21**Matrix:** DRINKING WATER**Collection Date:** 08/01/2023 10:18

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			< 1.0	µg/L	1	08/31/2023 23:37	



## Laboratory Results

<http://www.teklabinc.com/>

Client: Occu-Tec  
Client Project: 923206 VHS  
Lab ID: 23080301-019  
Matrix: DRINKING WATER

Work Order: 23080301  
Report Date: 05-Sep-23  
Client Sample ID: 206-VHS-22  
Collection Date: 08/01/2023 10:21

Analyses	Certification	RL	Qual	Result	Units	DF	Date Analyzed	Batch
Lead	NELAP			4.1	µg/L	1	08/31/2023 23:40	





## Receiving Check List

<http://www.teklabinc.com/>

Client: Occu-Tec

Work Order: 23080301

Client Project: 923206 VHS

Report Date: 05-Sep-23

Carrier: Crossroads

Received By: TWM

Completed by:

On:

03-Aug-23

Allison Colin

Reviewed by:

On:

04-Aug-23

Ellie Hopkins

Pages to follow: Chain of custody

2

Extra pages included

0

Shipping container/cooler in good condition?

Yes ☒

No ☐

Not Present ☐

Temp °C NA

Dry Ice ☐

Chain of custody present?

Yes ☒

No ☐

Chain of custody signed when relinquished and received?

Yes ☒

No ☐

Chain of custody agrees with sample labels?

Yes ☒

No ☐

Samples in proper container/bottle?

Yes ☒

No ☐

Sample containers intact?

Yes ☒

No ☐

Sufficient sample volume for indicated test?

Yes ☒

No ☐

All samples received within holding time?

Yes ☒

No ☐

Reported field parameters measured:

Field ☐

Lab ☐

NA ☒

Container/Temp Blank temperature in compliance?

Yes ☒

No ☐

Water – at least one vial per sample has zero headspace?

Yes ☐

No ☐

No VOA vials ☒

Water - TOX containers have zero headspace?

☐

☐

☒

Water - pH acceptable upon receipt?

☒

☐

NA ☐

NPDES/CWA TCN interferences checked/treated in the field?

☐

☐

☒

Any No responses must be detailed below or on the COC.

Samples were checked for turbidity and then preserved with nitric acid upon arrival at the laboratory.

Client: OCCU-TEC Inc.

Address: 2604 NE Industrial Drive Suite 230

City/State/Zip: North Kansas City, MO 64117

Contact: Justin Arnold

Email: jarnold@occutech.com

Phone: 816-810-3276

Fax: 816-994-3478

Are these samples known to be involved in litigation? If yes, a surcharge will apply: ☐ Yes ☒ No

Are these samples known to be hazardous? ☐ Yes ☒ No

Are there any required reporting limits to be met on the requested analysis?. If yes, please provide limits in the comment section: ☒ Yes ☐ No

PROJECT NAME/NUMBER

923206

SAMPLE COLLECTOR'S NAME

Nathaniel Jones

RESULTS REQUESTED

☒ Standard ☐ 1-2 Day (100% Surcharge)  
☐ Other ☐ 3 Day (50% Surcharge)

BILLING INSTRUCTIONS

Lab Use Only	Sample ID	Date/Time Sampled	Matrix
23080301 001	206-VHS-01	08/01/2023 9:26	Drinking Water
002	206-VHS-02	08/01/2023 9:30	Drinking Water
003	206-VHS-03	08/01/2023 9:30	Drinking Water
004	206-VHS-04	08/01/2023 9:30	Drinking Water
005	206-VHS-05	08/01/2023 9:35	Drinking Water
006	206-VHS-06	08/01/2023 9:35	Drinking Water
007	206-VHS-07	08/01/2023 9:40	Drinking Water
008	206-VHS-08	08/01/2023 9:42	Drinking Water
009	206-VHS-09	08/01/2023 9:42	Drinking Water
010	206-VHS-10	08/01/2023 9:42	Drinking Water
	206-VHS-11	08/01/2023 9:42	Drinking Water

Relinquished By

Nathaniel Jones

Date/Time

8/2/2023 8:00

Received By

L. [Signature]

Date/Time

8/2/23 1400

Samples on: ☐ ICE ☐ BLUE ICE ☒ NO ICE NA °C

Preserved in: ☒ LAB ☐ FIELD FOR LAB USE ONLY

LAB NOTES:

Client Comments:

<5ppb

# and Type of Containers

UNP HNO3 NaOH H2SO4 HCL MeOH NaHSO4 TSP Other

INDICATE ANALYSIS REQUESTED

Lead by 200.8

\*The individual signing this agreement on behalf of the client, acknowledges that he/she has read and understands the terms and conditions of this agreement, and that he/she has the authority to sign on behalf of the client. See [www.teklabinc.com](http://www.teklabinc.com) for terms and conditions

## CHAIN OF CUSTODY

Pg 2 of 2 Workorder # 23080301

TEKLAB INC, 5445 Horseshoe Lake Road, Collinsville, IL 62234 Phone (618) 344-1004 Fax (618) 344-1005

Client: OCCU-TEC Inc. Address: 2604 NE Industrial Drive Suite 230 City/State/Zip: North Kansas City, MO 64117 Contact: Justin Arnold Phone: 816-810-3276 Email: jarnold@occutech.com Fax: 816-994-3478				Samples on: <input type="checkbox"/> ICE <input type="checkbox"/> BLUE ICE <input type="checkbox"/> NO ICE _____ °C Preserved in: <input type="checkbox"/> LAB <input type="checkbox"/> FIELD <u>FOR LAB USE ONLY</u> LAB NOTES:  Client Comments: <5ppb			
Are these samples known to be involved in litigation? If yes, a surcharge will apply: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Are these samples known to be hazardous? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No Are there any required reporting limits to be met on the requested analysis? If yes, please provide limits in the comment section: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No							
PROJECT NAME/NUMBER 923206		SAMPLE COLLECTOR'S NAME Nathaniel Jones		# and Type of Containers		INDICATE ANALYSIS REQUESTED	
RESULTS REQUESTED		BILLING INSTRUCTIONS		UNP HNO3 NaOH H2SO4 HCL MeOH NaHSO4 TSP Other Lead by 200.8			
<input checked="" type="checkbox"/> Standard <input type="checkbox"/> 1-2 Day (100% Surcharge) <input type="checkbox"/> Other <input type="checkbox"/> 3 Day (50% Surcharge)							
Lab Use Only	Sample ID	Date/Time Sampled	Matrix				
23080301 011	206-VHS-12	08/01/2023 9:55	Drinking Water				
012	206-VHS-14	08/01/2023 9:55	Drinking Water				
013	206-VHS-15	08/01/2023 9:55	Drinking Water				
014	206-VHS-16	08/01/2023 9:55	Drinking Water				
015	206-VHS-17	08/01/2023 10:01	Drinking Water				
016	206-VHS-18	08/01/2023 10:01	Drinking Water				
017	206-VHS-20	08/01/2023 10:01	Drinking Water				
018	206-VHS-21	08/01/2023 10:18	Drinking Water				
019	206-VHS-22	08/01/2023 10:21	Drinking Water				
			Drinking Water				
			Drinking Water				
Relinquished By		Date/Time	Received By		Date/Time		
[Signature]		8/02/2023 8:00	[Signature]		8/2/23 1400		
[Signature]		8/2/23 1000	[Signature]		8-3-23 1150		

\*The individual signing this agreement on behalf of the client, acknowledges that he/she has read and understands the terms and conditions of this agreement, and that he/she has the authority to sign on behalf of the client. See [www.teklabinc.com](http://www.teklabinc.com) for terms and conditions